



LINE TAPS & ACCESS FITTINGS

Line Taps

Diversitech DLT Line Taps and Control Valve

The quick, safe and easy option to charge, recover and test a line. Simply clamp on the DLT valve, attach the DCV-1G control valve, and pierce the line. The control valve features a port for connecting charging lines or gauges. The valve can swivel to any position and also be removed and re-used. Available in three sizes from 3/16". OD tube size to 5-1/6". The DCV-1G is designed for use with all three sizes.



CODE	MODEL	TO SUIT PIPE (INCH)
P010	DLT-3G	3/16
P011	DLT-4G	1/4
P012	DLT-5G	5/16
P016	DCV-1G	Control Valve

Supco BPV 31 Bullet Piercing Valve


The ONLY valve with a permanent type, patented gasket application. Sealing force of over 180 inch lbs, torque tested with 450 lbs. Pressure tested at 250°f patented valve gasket provides 50 times more sealing area than competitive 'O' ring types, corrosion resistant piercing needle is engineered for concentricity and hardness to insure perfect seating every time. 500 psi maximum pressure. No adapter valve required, requires only 2" clearance for installation and operation hex key wrench included.



CODE	MODEL	TO SUIT
P008	BPV-31	1/4, 5/16, 3/8

Diversitech Quick Tap


Features a schrader valve core in the 1/4" male port. Simply pierce the line and back seat the needle. Flow starts when depressor type charging hose is connected. Flow shuts off automatically when hose is removed. If valve core is not desired, it may be removed. Connect hose, pierce line and back seat needle. This method offers full unrestricted flow. Valve core can be removed or changed at any time without loss of refrigerant if needle is front seated.

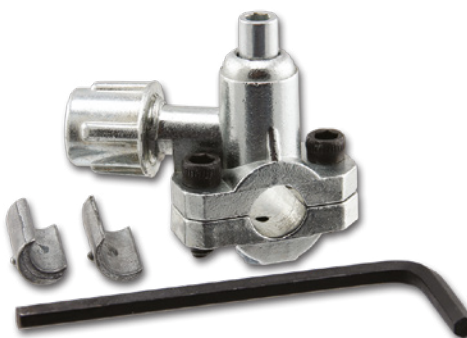

CODE	MODEL	TO SUIT
P019	QT-1	1/4, 5/16, 3/8

Diversitech Quick Tap 2

Identical to the Quick-Tap except that a nylon handle replaces the hex wrench and Phillips head screws are used.

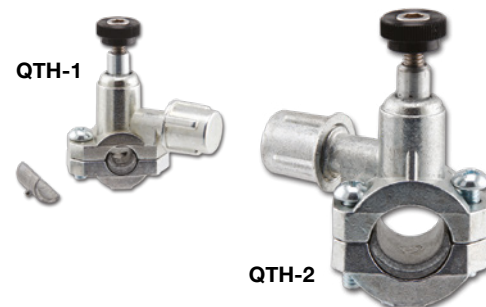

CODE	MODEL	TO SUIT
P022	QTH-1	1/4, 5/16, 3/8
P023	QTH-2	1/2, 5/8

MAC - The Ultimate Line Piercing Valve


Mac valve features a uniport single connection for piercing and servicing. Needle depressor is inserted into head of needle. Wing cap is turned down easily by hand until line is pierced. Sealed with refrigerant resistant 'O' rings the needle automatically back seats after servicing. Very compact line tap valve when access is an issue.



CODE	MODEL	TO SUIT
P025	QTM-1	1/4, 5/16, 3/8

Access Fittings

We offer a wide range of access valves and fittings designed for quick and easy installation for both service and installation work. They can be installed anywhere on either the low side for charging, purging, quick testing or pressure checking. Our access fittings have 1/4 SAE male flare access ports and include a quick seal cap and have a stainless and brass core Schrader valve fitted.

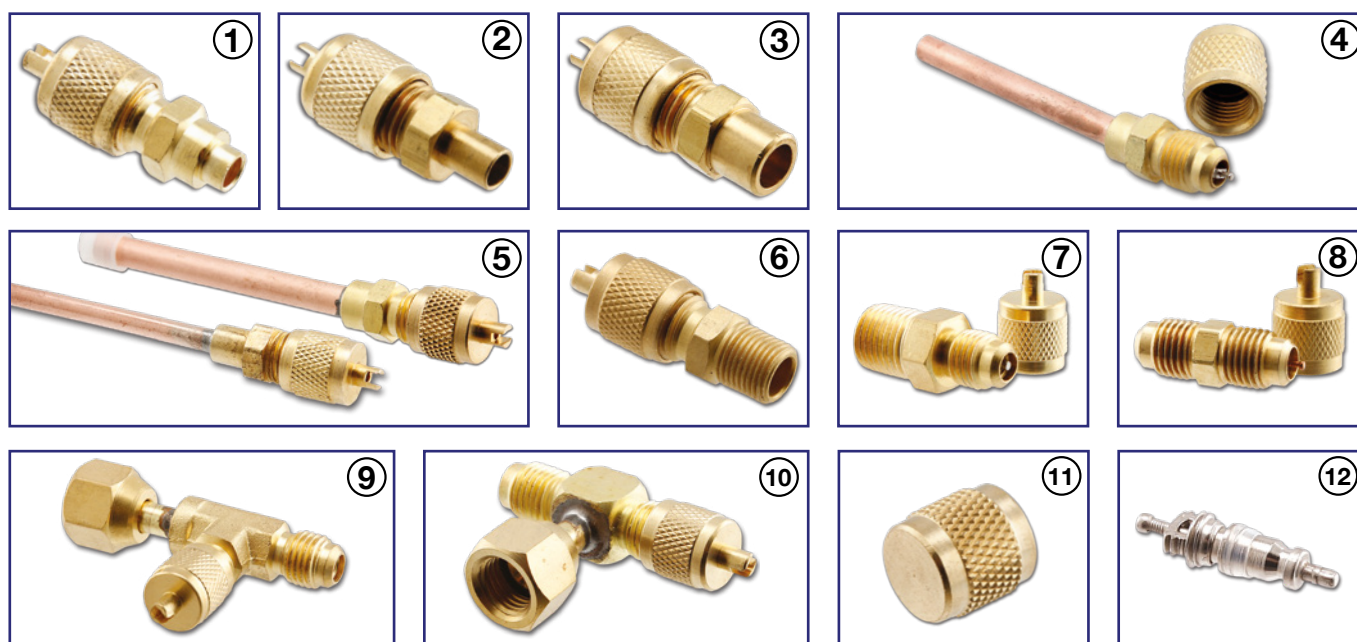

CODE	MODEL	DESCRIPTION	IMAGE NUMBER
P030	VA-3-346	3 way straight solder 3/16, 1/4, 3/8 Schrader valve	1
P031	VA-34	2 way straight solder 3/16, 1/4 Schrader Valve	2
P032	VA-46	2 way straight solder 1/4 or 3/8 Schrader Valve	3
P037	4048-516	Extended 1/4 copper tube with 5/16 Flare Schrader Valve	4
P033	SU-03	Extended 3/16 copper tube with 1/4 Flare Schrader Valve	5
P034	SU-04	Extended 1/4 copper tube with 1/4 Flare Schrader Valve	5
P035	VAU-24	1/8 MPT x 1/4 Flare Schrader Valve	6
P036	VAU-45	1/4 MPT x 1/4 Flare Schrader Valve	7
P038	VUR-4	1/4 Flare x 1/4 Flare Union C/W Flare Cap and Schrader	8
P039	VST-44	1/4 Swivel Tee with Depressor Female 1/4 Swivel Flare Nut with Depressor on Run 1/4 Male Schrader Access on Run - Branch 1/4 MFL	9
P040	VST-4	1/4 Swivel Tee with Depressor 1/4 Male Schrader Access on Run, 1/4 Male Flare on Run 1/4 Female Swivel Flare Nut with Depressor on Branch	10
P041	VC-4	1/4 Flare Cap	11
P042	VC-6400	Pack of 10 Spare Schrader Cores	12

Core Removal Tools

The P100 is a simple but handy schrader core removal tool Complete with spare schrader cores that store in the lid.

Draper Schrader Core Torque Driver Allows replacement of Schrader valve cores to the correct torque.

Max torque 0.60Nm. Clicks when correct tightness is reached.

CODE	DESCRIPTION
P100	90376 Schrader Core Remover c/w Spare Cores
QD1070	Draper Schrader Core Torque Driver

Check out our full range of Core Removal Tools from Appion, Fieldpiece & NAVTEK see page 293 for details...





MAXIMIZING JOBSITE
EFFICIENCY



Leading the HVAC/R industry by providing high-quality, **RELIABLE** tools designed for **EFFICIENCY** while continuously driving industry advancements through **INNOVATION** and **EDUCATION**.

